

Manhole Inspection Summary

Manhole # S03Q__031MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **2) Good**

Record Plat: **03Q** Node: **031** Status: **Found**

Insp Date: **6/24/08 1:12 PM**

Incomplete Comments

Crew: **BC JD**
Inspector: **Chung**
Firm: **URS**

Location Address: **4350 ELDONE RD**

Cross Street: **YALE AVE**

Manhole Type: **Junction** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **4** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **7** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View




Top View



OFFSET




GRADE ADJUSTMENT

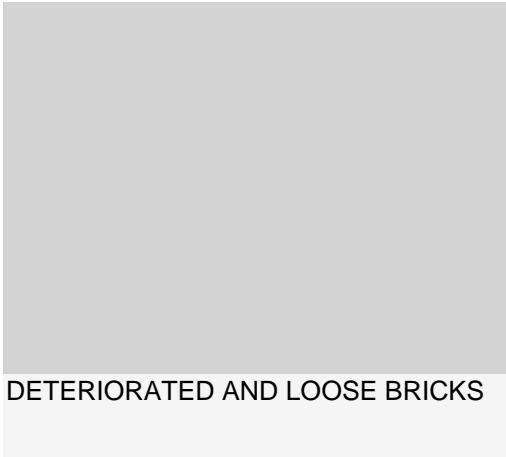

DETERIORATED AND LOOSE BRICKS

Defect 1

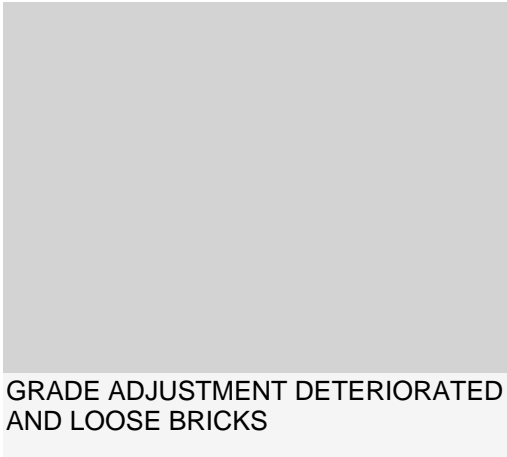

GRADE ADJUSTMENT DETERIORATED
AND LOOSE BRICKS

Manhole Inspection Summary

Manhole # S03Q__031MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow

Drop In @ 3 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.30** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar
Angled: **Yes** Reading: **7.80** (ft.)
Inv Depth: **8.80** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**


☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock

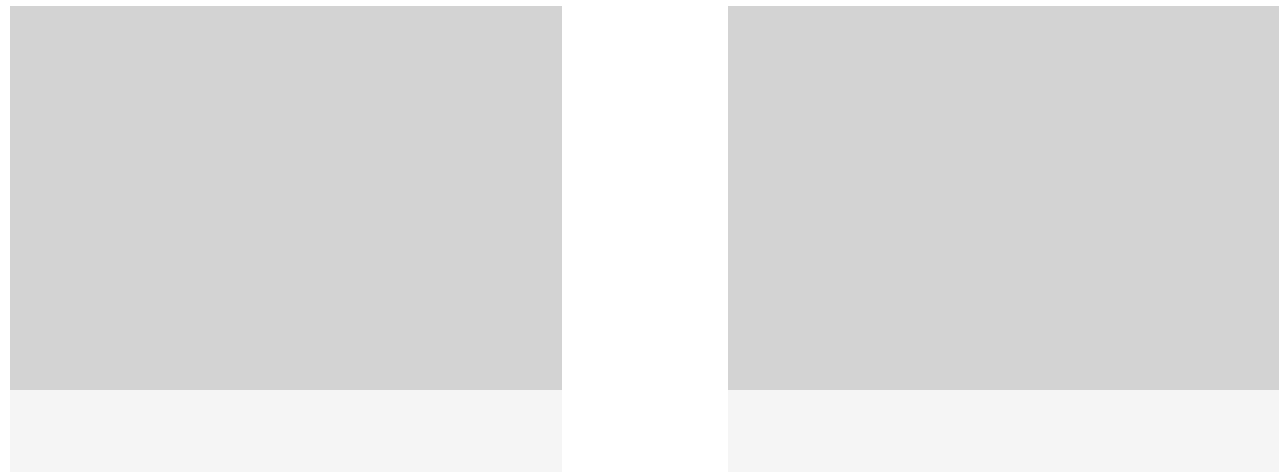

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **7.70** (ft.)

Inv Depth: **8.70** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection